


Running Kodak i1400 ISIS driver 1.1.11308.13005 with Kofax VRS.

If you get the “Scanner driver eki1440.pxn for scanner Kodak i1440 is not installed.” error after installing the Kodak i1400 driver 1.1.11308.13005 when running Kofax VRS you will need to implement the following changes.

This ISIS driver is included in the Kodak i1400 Installation CD version 3.8 and in driver installer package version “InstallSoftware_i1400_v3.8.exe”

The problem could occur on a Kodak i1420 or Kodak i1440 scanner.

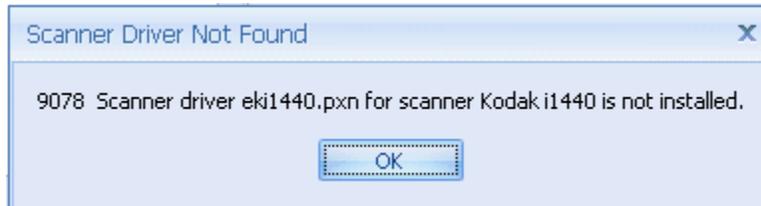

To correct this problem:

The file “eki1400.pxn” file in the directory “C:\Windows \Pixtran\” will need to be renamed to “eki1420.pxn” for a Kodak i1420 scanner or “eki1440.pxn” for a Kodak i1440 scanner.